
MELT BOLT THERMOCOUPLES WITH ARMOR EXTENSION

STYLE MA FOR THE PLASTICS INDUSTRY

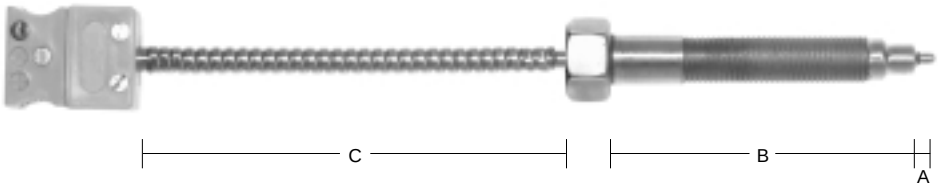

- Stainless steel melt bolt
- Stainless steel probe
- Fiberglass insulated probe
- Type J and K thermocouples for use up to 900°F (482°C)
- Type T thermocouple for us up to 700°F (371°C)
- Stainless steel flex armor

ORDERING INFORMATION

M	**A**	1	2	–	3	4	4	4	–	5	6	–	7	7	7	8	9

To create an ordering code fill in the boxes above with the appropriate number and/or letter from the corresponding box below.

Box 1: Calibration Code

J = J Type, ANSI Standard Tolerances
K = K Type, ANSI Standard Tolerances
T = T Type, ANSI Standard Tolerances

Box 2: Number of Junctions

1 = Single (Standard)
2 = Duplex T/C (Not available in 1/8" sheath)

Box 3: Junction*

G = Grounded
U = Ungrounded
** Dual ungrounded junctions are isolated*

Box 4: Sheath O.D. *enter 3 digit code*

125 = 1/8"
188 = 3/16"

Box 5: Tip Length "A"

0 = Flush
1 = 1/8"
2 = 1/4"
3 = 3/8"
4 = 1/2"
5 = 5/8"
6 = 3/4"
7 = 7/8"
8 = 1"

Box 6: Bolt Length "B"

3 = 3"
4 = 4"
6 = 6"
9 = 9"

Box 7: Extension Length "C" *fill in measurement desired*

Whole inches: 006" to 999"
(Lengths over 999" consult TTI)

Box 8: Termination

A = 3/4" Stripped Leads
B = Spade Lugs
C = Spade Lugs with BX Connector
D = Standard Male Plug (350°F/177°C)
E = Medium-Temp. Male Plug (500°F/260°C)
F = High-Temp. Male Plug (800°F/426°C)
G = Standard Female Jack (350°F/177°C)
H = Medium-Temp. Female Jack (500°F/260°C)
J = High-Temp. Female Jack (800°F/426°C)
K = Miniature Male Plug (350°F/177°C)
L = Miniature Med-Temp. Male Plug (500°F/260°C)
M = Miniature Female Jack (350°F/177°C)
N = Miniature Med-Temp. Female Jack (500°F/260°C)

Box 9: Special Limits of Error

N = None
S = Special Tolerance Wire